

Tension Meter

SCHMIDT
control instruments




Edition TSR 01.1.E

TS Series

Model TSR

Instruction Manual

Valid as of: 01.01.2015 • Please keep the manual for future reference!

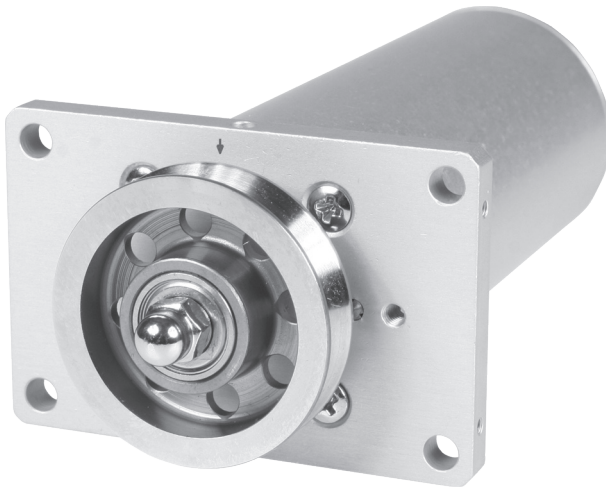

SCHMIDT · 1ST IN TENSIONMETERS WORLDWIDE

Contents

1 Warranty and liability	3
1.1 Notices within the instruction manual.....	3
1.2 Responsibilities of the operating company.....	3
1.3 Responsibilities of the personnel	3
1.4 Informal safety measures.....	4
1.5 Training of the personnel	4
1.6 Intended use	4
1.7 Dangers in handling the device.....	4
1.8 Copyright.....	4
1.9 Declaration of conformity, RoHs II and WEEE registration	4
2 Available models	5
2.1 General information.....	5
2.2 Specifications	5
2.3 Assignment of the connector.....	6
2.3.1 Connecting the tension meter.....	6
2.4 Optional accessories.....	6
2.5 Delivery includes.....	6
2.6 Unpacking	6
3 Operating procedure	7
3.1 Initial setup	7
3.2 Determining the tension range	8
3.3 Internal adjustment of the sensors.....	8
3.3.1 Zero adjustment.....	8
3.3.2 Gain adjustment	9
4 Service and maintenance	10
4.1 Rollers.....	10
5 Cleaning	10
6 Verification interval	10
6.1 Verification of calibration and determination of repair costs.....	11
7 Correspondence	12
8 Repairs	12

1 Warranty and liability

In principle, the supply of the device is subject to our “General Conditions of Sale and Delivery.” These have been provided to the operating company on conclusion of the contract, at the latest.

Warranty:

- SCHMIDT tension meters are warranted for 12 months.
- Parts subject to wear, electronic components and measuring springs are not covered by the warranty. No warranty or liability will be accepted for bodily injury or property damage resulting from one or several of the following causes:
 - Misuse or abuse of the device.
 - Improper mounting, commissioning, operation and maintenance of the device (e.g. verification interval).
 - Operation of the device if any safeguards are defective or if any safety and protection precautions are not properly installed or not operative.
 - Failure to comply with the notices in the instruction manual regarding transport, storage, mounting, commissioning, operation, maintenance and setup of the device.
 - Any unauthorized structural alteration of the device.
 - Insufficient inspection of device components that are subject to wear.
 - Opening the device or improper repair work.
 - Disasters caused by the effects of foreign objects or by force majeure.

1.1 Notices within the instruction manual

The fundamental prerequisite for the safe handling of this device and its troublefree operation is the knowledge of the basic safety notices and safety instructions.

These instruction manual contains the most important notices for the safe operation of the device.

These instruction manual, in particular the safety notices, must be observed by any person who works with the device. In addition, the local valid rules and regulations for the prevention of accidents must be complied with.

The representations within the instruction manual are not true to scale.

The dimensions given are not binding.

General indications of direction, such as FRONT, REAR, RIGHT, LEFT apply when viewing the front of the device.

1.2 Responsibilities of the operating company

In compliance with the EC Directive 89/655/EEC, the operating company agrees to only permit persons to work with the device who:

- are familiar with the basic regulations on industrial safety and accident prevention and who have been trained in handling the device.
- have read and understood the chapter on safety and the warning notices in these instruction manual and have confirmed this with their signatures.
- are examined regularly on their safe and conscientious working method.

1.3 Responsibilities of the personnel

All persons who work with the device agree to perform the following duties before starting work:

- to observe the basic regulations on industrial safety and accident prevention.
- to read the chapter on safety and the warning notices in these instruction manual and to confirm with their signatures that they have understood them.

1.4 Informal safety measures

The instruction manual must always be kept on hand where the device is operated. Apart from the instruction manual, the general and local valid regulations on accident prevention and environmental protection must be provided and complied with.

1.5 Training of the personnel

Only trained and instructed personnel is permitted to work with the device. The responsibilities of the personnel must be clearly defined for mounting, commissioning, operation, setup, maintenance, and repair. Trainees may only work with the device under the supervision of experienced personnel.

1.6 Intended use

The device is intended exclusively to be used as a tension meter.

Any other use or any use exceeding this intention will be regarded as misuse.

Under no circumstances shall Hans Schmidt & Co GmbH be held liable for damage resulting from misuse.

The intended use also includes:

- Complying with all notices included in the instruction manual and observing all inspection and maintenance works.

1.7 Dangers in handling the device

The device was designed according to the state of the art and the approved safety standards. Nevertheless, its use may cause serious or fatal injury to the user or third persons, and/or an impairment of the device or of other material assets.

The device may only be applied:

- For its intended use in a faultless condition with regard to the safety requirements.
- Malfunctions that could impair safety must be remedied immediately.
- Personal protective equipment must be used according to the EC Directive 89/686/EEC.



The device must not be operated in potential explosive areas and must not come into contact with aggressive substances.

1.8 Copyright

The copyright on these instruction manual remains with the company Hans Schmidt & Co GmbH.

These instruction manual is intended for the operating company and its personnel only.

They contain instructions and notices that may only be reproduced on the prior written permission of

Hans Schmidt & Co GmbH

and under indication of the complete reference data.

Violations will be prosecuted.

1.9 Declaration of conformity, RoHs II and WEEE registration

In compliance with the EU Directives 2014/30/EU and 2011/65/EU



Hans Schmidt & Co GmbH is registered in compliance with the German Electrical and Electronic Equipment Act (ElektroG) under WEEE Reg. No. DE 48092317.

2 Available models

2.1 General information

These instruction manual refer to the TSR model of the TS series

The individual models of the TS series are also available with the following modifications (customized versions):

Model	Tension Ranges N
TSR-10N	0 - 10
TSR-20 N	0 - 20
TSR-50 N	0 - 50
TSR-100 N	0 - 100
TSR-200N	0 - 200

Guide rollers:

V-Groove	Line Speed m/min ... max.	Groove Ø in mm	Roller Material
Standard	4000	29.5	Stainless steel 1.4125
Code R1	4000	29.5	Hard chrome-plated steel (radius R5)
Code F	4000	70	Hard-coated aluminium
Code FB	4000	70	Tempered steel
flat Code B6	2000	29.5	Hardened steel, width 6 mm
Code B10	2000	29.5	Hardened steel, width 10 mm

2.2 Specifications

Calibration:	According to SCHMIDT factory procedure
Accuracy:	± 1 % full scale and ± 1 digit Other calibration material: ± 3 % full scale or better
Overload protection:	100 % of range
Measuring principle:	Strain gauge bridge
Meas. roller deflection:	0.5 mm, max.
Natural frequency of measuring spring:	Approx. 500 Hz, depending on tension range
Signal processing:	Analog
Output signal:	0 - 1 V, impedance: 5 kOhm (Standard)
Option Code A2	0 - 10 V DC
Option Code A3	4 - 20 mA
Option Code A10	analog - DMS output mV/V without amplifier
Damping (f_g):	Standard: 30 Hz (other values on request)
Temperature coefficient:	Zero point: less than ± 0.05 % full scale/°C
Temperature range:	10 - 45 °C
Air humidity:	85 % RH, max.
Power supply:	15 to 24 V DC (50 mA regulated)
Housing:	Aluminium
Weight:	Approx. 250 g

2.3 Assignment of the connector

- 1** To assure immunity to random noise, the measuring head must be installed in such a way that it is insulated from ground (GND).
The shield of the connecting cable must be connected to the metal housing of the connecting plug.

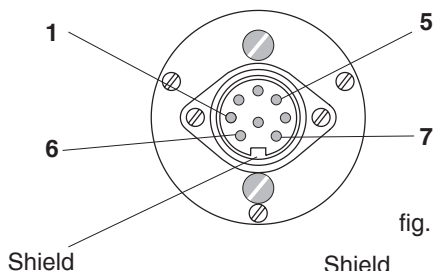


fig. 2.3a

Pin assignment (viewed from outside):

- 5 - Vcc + 15 to 24 V DC regulated
 - 6 - Ground - Vcc
 - 1 - Ground - analog signal
 - 7 - Signal output
- Pins 2 - 3 - 4 - 8 not assigned

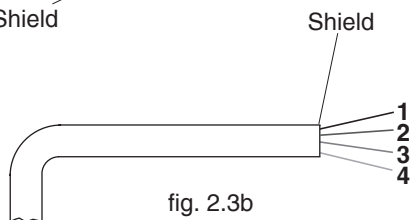


fig. 2.3b

Strand assignment of cable EK0612:

- 1 (white) - Ground - analog signal
- 2 (grey) - Signal output
- 3 (pink) - Ground - Vcc
- 4 (yellow) - Vcc + 15 to 24 V DC regulated

2.3.1 Connecting the tension meter

- CE** The requirements of the CE specification are only complied with if the tension sensor is equipped and operated with display units and connecting cables supplied by Hans Schmidt & Co GmbH. Certification to the CE specification does not extend to, and shall be invalid for any other combination. Under no circumstances shall Hans Schmidt & Co GmbH be held liable for any damage resulting from the use of non-SCHMIDT sensors or cables.

2.4 Optional accessories

- Code **A2**: Analog output 0 - 10 V DC
- Code **A3**: Analog output 4 - 20 mA
- Code **A10**: Analog DMS output mV/without amplifier

- E10061 Diode plug with bayonet cap
- EK0603 Connecting cable with 2 diode plugs, length 3 m
- EK0605 Connecting cable with 2 diode plugs, length 5 m
- EK0610 Connecting cable with 2 diode plugs, length 10 m
- EK0612 Connecting cable with 1 diode plug and open ends, length 3 m
- EK0614 Connecting cable with 1 diode plug and open ends, length 5 m
- EK0615 Connecting cable with 1 diode plug and open ends, length 10 m

2.5 Delivery includes

- Sensor
- Instruction manual

2.6 Unpacking

Unpack the instrument and inspect it for any shipping damage. Notices of defect must be announced immediately, in writing, at the latest within 7 days on receipt of the goods.

3 Operating procedure



Tensions that exceed the tension range of the instrument by more than 100% may cause permanent damage to the measuring spring and must be avoided under any circumstances.

CE conformity testing was carried out and successfully passed by Hans Schmidt & Co GmbH with a complete unit consisting of:
TSR sensor, SCD-1 display unit and an 5 m long connecting cable (special cable).

In no event shall Hans Schmidt & Co GmbH take over any warranty coverage for, or shall be held liable for, any damage resulting from self-made cables.



The model number, the serial number, the calibration label (option) and the SCHMIDT Quality Seal are provided on the cylindrical portion of the sensor.

3.1 Initial setup

- If the sensor is delivered with the standard roller, it is already mounted in the factory. If the device is supplied with a roller code F, FB, R1, B6 or B10, it must be installed. Tight the cap nut with 1 Nm.
- Install the sensor at the desired measuring location using the 4 provided mounting holes. To avoid damage of the load cell, the transmission of force has to occur in direction of the arrow. The direction of force is the angle bisector.
- Connect the sensor to the supplied or existing display unit.
The pin assignment of the 8-pin connector located on the rear side of the sensor is described in chapter 2.3
- If the material path is other than vertical or if the process material deviates significantly from the SCHMIDT calibration material, you need to carry out zero adjustment and gain adjustment as described in chapters 3.2.1 and 3.2.2 before starting measurement.
- Allow approx. 10 minutes for thermal stabilization of the sensor.
- Thread the process material through the measuring roller, following the arrow on the front of the sensor.


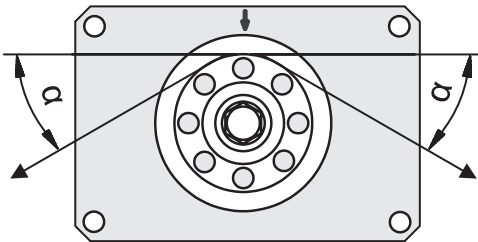


fig. 3.1

3.2 Determining the tension range

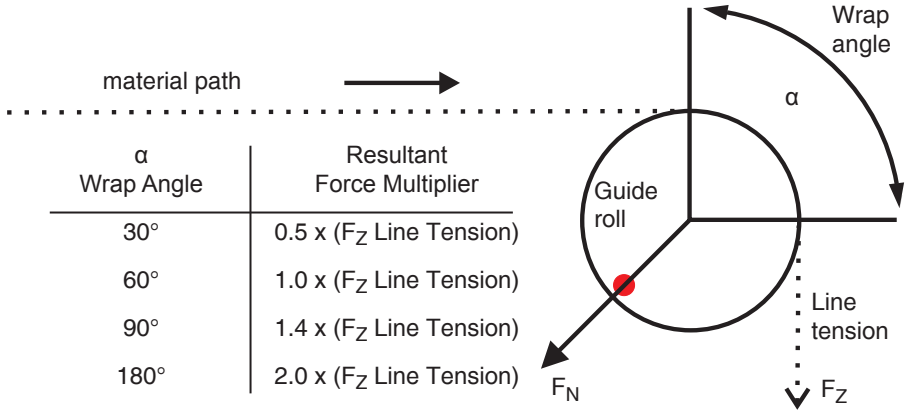

$$F_N = \text{Multiplier} \times F_Z$$

Recommended wrapping angle 40 - 180°

The tension range can be calculated for every wrapping angle with this formula:

F_N = Nominal load (multiplier x F_Z)

F_Z = Line tension

α = Wrapping angle at the guide roll

$$F_N = 2 \cdot F_Z \cdot \sin \frac{\alpha}{2}$$

3.3 Internal adjustment of the sensors

General information:

All tension meters are calibrated with standard materials - such as polyamide monofilament (PA) - according to the SCHMIDT factory procedure; therefore the wrapping angle is 180°.



In any case you need to carry out static zero and gain adjustment as described in chapters 3.3.1 and 3.3.2.

3.3.1 Zero adjustment

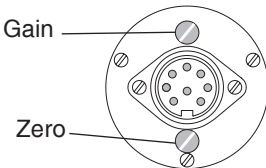


fig. 3.3.1a

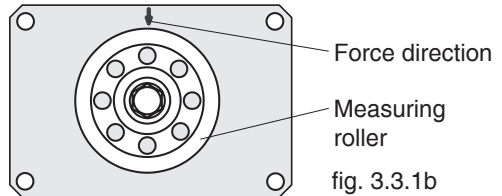


fig. 3.3.1b

- Install the sensor in the desired position at the measuring location using the provided mounting holes.
- Screw the countersunk bolts (M2.5) labeled zero and gain all the way out on the rear side of the sensor.
- Allow approx. 10 minutes for thermal stabilization of the sensor.

3.3.1 Zero adjustment



Since zero and gain adjustments are always performed statically, the readings may differ under dynamic load.

- Connect a volt meter to the yellow and green leads of the connecting cable
- Adjust the potentiometer, which you can reach through the zero hole in the housing, with a screwdriver (with a point width of max. 1.9 mm) until the display of the connected volt meter reads 0 cN = display 0 V,



Do not insert the screwdriver at an angle as this may damage the potentiometer.

3.3.2 Gain adjustment

Requirement: Zero adjustment carried out.

Thread the process material in the measuring roller

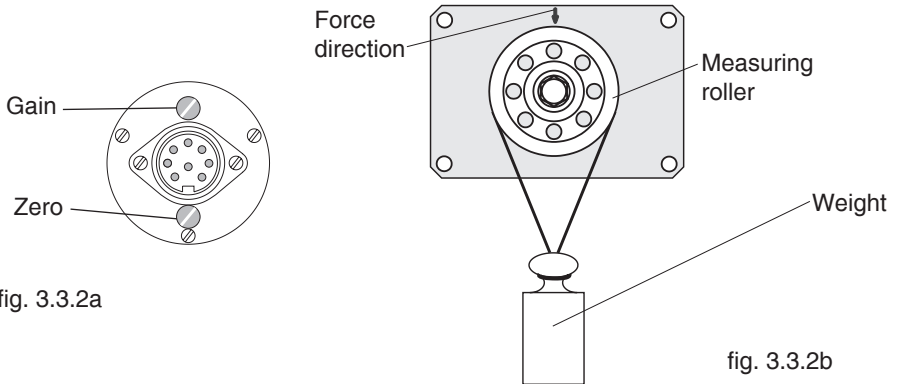


fig. 3.3.2a

fig. 3.3.2b

- Hang a weight that corresponds 100% of the tension range from the process material.
- Adjust the potentiometer, which you can reach through the gain hole in the housing, with a screwdriver (with a point width of max. 1.9 mm) until the display of the connected volt meter reads, for example:
Sensor model TSR - 20N:
Weight 20 N = Displays 1 V for TSR standard version
or
Weight 20 N = Displays 100 V for TSR version with 10 V output signal.
- Check the adjustments with a new filament of the process material and repeat the procedure, if required, as described in chapters 3.2.1 and 3.2.2.
- Screw the zero and gain countersunk bolts back in on the rear side of the sensor.



Do not insert the screwdriver at an angle as this may damage the potentiometer.

Gain adjustment of sensors with output signal Code A10 has to be realized with display unit.

4 Service and maintenance

The tension meter is easy to maintain. Depending on operating time and load, the instrument should be checked according to the locally valid regulations and conditions (as described in chapter 3.3). The use of other test methods than the procedure described in chapter 3.3 may cause deviating measuring results.

4.1 Rollers

You should regularly inspect the rollers to assure that they are running easily and smoothly. You can replace the rollers yourself, as necessary. Please indicate the tension meter model and the serial number in your spare-parts order.

5 Cleaning

For cleaning the unit, do not use any



AGGRESSIVE SOLVENTS

such as trichloroethylene or similar chemicals.



NO WARRANTY OR LIABILITY

shall be accepted for damage resulting from improper cleaning.

6 Verification interval

The question of finding the right frequency of calibration accuracy verification depends on several different factors:


- ➔ Operating time and load of the SCHMIDT tension meter
- ➔ Tolerance band defined by the customer
- ➔ Changes to the tolerance band compared to previous calibrations

Therefore, the interval between verifications of calibration must be determined by the user's Quality Assurance Department, based on the user's experience.

Assuming normal operating time and load as well as careful handling of the tension meter, we recommend a verification interval of one year.

6.1 Verification of calibration and determination of repair costs

Flow chart for verifying the calibration of used tension meters, incoming and outgoing verification with Inspection Certificate 3.1 according to DIN EN 10204

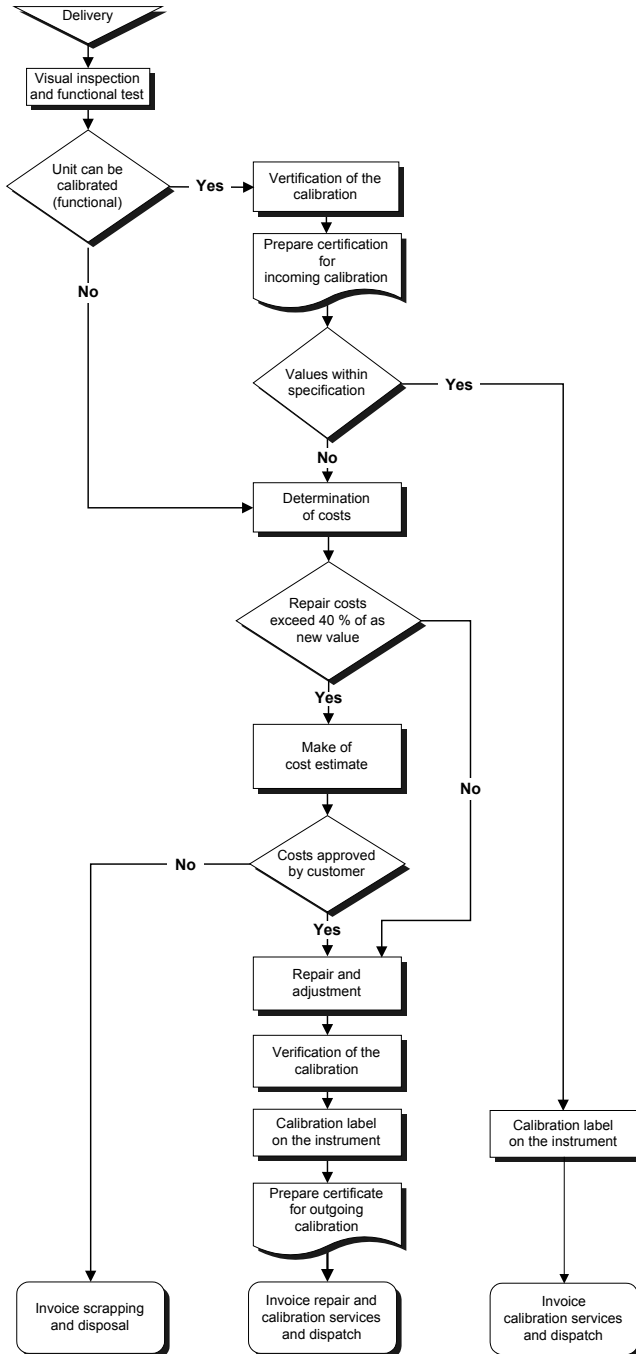

7 Correspondence

Should you have any questions regarding the instrument or instruction manual, or their use, please indicate above all the following details which are given on the ID plate:

- 1) Model
- 2) Serial number

8 Repairs

Shipping instructions:

We kindly ask for return free of charge for us, if possible by airmail parcel. All occurring charges, if any (such as freight, customs clearance, duty etc.), will be billed to customer. For return from foreign countries, we ask you to include a proforma invoice with a low value for customs clearance only, e.g. 50 Euro, each and to advise the shipment in advance by fax or eMail.

1 To avoid unnecessary follow-up questions, and the resulting loss of time or possible misunderstandings, please return the instrument with a detailed fault description to our service department. Please indicate in your order whether you require an Inspection Certificate 3.1 according to DIN EN 10204.

Service address:

**Hans Schmidt & Co GmbH
Schichtstr. 16
84478 Waldkraiburg
Germany**

Subject to change without notice!

Notes:

More than 75 years - Worldwide -

Hans Schmidt & Co GmbH

Mailing address:

P. O. B. 11 54
84464 Waldkraiburg Germany

Shipping address:

Schichtstr. 16
84478 Waldkraiburg Germany

Phone:

int. + 49 / (0)8638 / 9410-0

Fax:

int. + 49 / (0)8638 / 4825
int. + 49 / (0)8638 / 67898

e-mail:

info@hans-schmidt.com

Internet:

<http://www.hans-schmidt.com>